

MONUMENT RECORD

Corner I.D. #


R-39

R-15

STATE OF INDIANA - COUNTY OF MONROE

Section Twenty-three 23, Township 9 North, Range 1 East

Monument Description & Remarks: Found Rectangular Stone, .7' x .5',
exposed .7' out of ground at the SE Corner of SW 1/4 of NW 1/4.
Corner witnessed 6/14/83. Steel fence post driven beside stone.

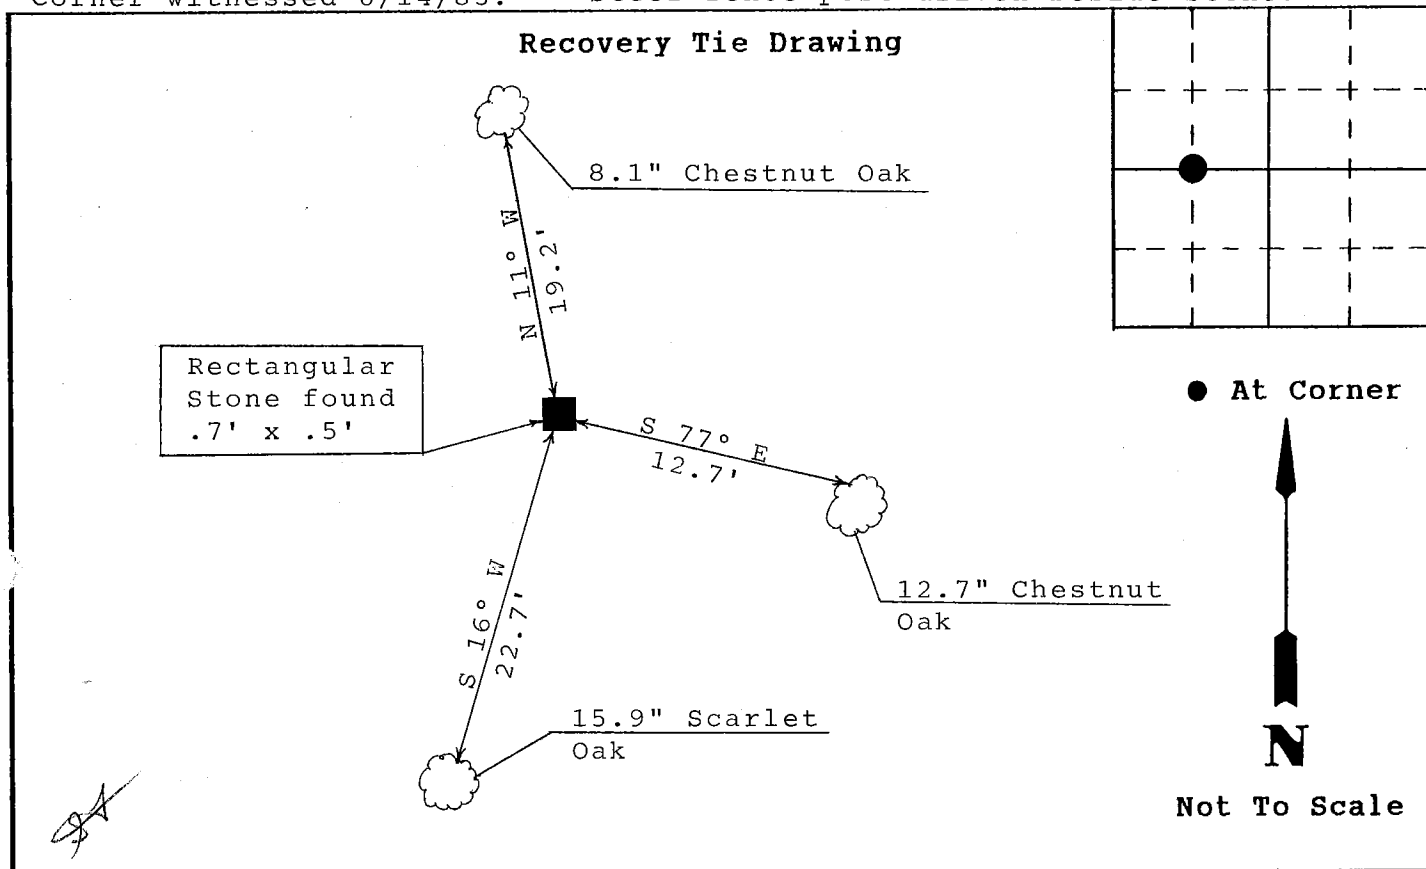

State of Indiana

County of Monroe

Space
Reserved For
Recording
Officer

I, Michael W. Friley, County Surveyor, hereby certify
that this document was prepared under my direction in
accordance with the provisions of Section 17-3-64-4
through 17-3-64-8 of the Indiana Code, being Acts of 1965,
Chapter 319; and the above data is given under my hand and
seal this 20th day of October, 1993 A.D.

Indiana Registered Land Surveyor No. _____ or

Morgan-Monroe State Forest

United States Government Agency

Bill Hahn, Property Manager

Title

Field Book:

n/a

Page:

n/a

SECTION 23, T 9 N, R 1 E

1. On June 14, 1983, I located and marked boundaries in this section as follows:

EW line on S side, $S\frac{1}{2}$, $NW\frac{1}{4}$. Double boundary signs were placed at turning corners and single boundary signs were placed on continuous lines at $\frac{1}{4}$ mile marks. Two corner stones were located and witnessed as follows: (1) at 11:45 AM (hot, sunny), SE corner of $SW\frac{1}{4}$, $NW\frac{1}{4}$ a rectangular stone .7' X .5' exposed .7', 19.2' to a 8.1" chestnut oak bearing ^{$\approx S\frac{1}{2}$?} 349° , 12.7' to a 12.7" chestnut oak bearing ^{$\approx 11^\circ W$} 103° , 22.7' to a 15.9" scarlet oak bearing ^{$\approx 17^\circ E$} 196° . (2) at 1:56 PM (hot, sunny), SW corner of $SW\frac{1}{4}$, $NW\frac{1}{4}$ a rectangular stone 1.0' X .3' exposed .8', 25.6' to a 12.0" scarlet oak bearing ^{$\approx S\frac{1}{2}$?} 193° , 25.4' to a 10.9" scarlet oak bearing ^{$\approx 16^\circ W$} 244° , 9.6' to a 12.5" black oak bearing 328° . A steel fence post was driven by each cornerstone witnessed. Tree lines were painted boundary orange on the state side of the tree.

#1
drawn
10-20-93

Bill Hahn, Property Manager

2. On June 29, 1983, I located and marked the NS line of the $SW\frac{1}{4}$, $NW\frac{1}{4}$, W side. Double boundary signs were placed at the turning corners. Tree lines were painted boundary orange on the state side of the tree. A corner stone at the NW corner $SW\frac{1}{4}$, $NW\frac{1}{4}$ was witnessed on 6-14-73 at 2:37 PM as follows: (hot, sunny); stone was rounded and nearly flush to the ground. The stone measured .8' X .3' and was exposed .15', 13.8' to a 14.6" white oak bearing 047° , 6.25' to a 3.8" dogwood bearing 158° , 15.9' to a 5.6" scarlet oak bearing 290° . A steel fence post was driven next to the stone on 6-29-83.

Bill Hahn, Property Manager